Ground Control Point Survey Report

"CA_FEMA R9 Lidar_2016_D17" COW CREEK

USGS Contract: G10PC00013 Task Order Number: G17PD00044

Prepared for: United States Geological Survey (USGS)







Prepared By:

Dewberry Consultants LLC

10003 Derekwood Lane, Suite 204 Lanham, Maryland, 20706 Phone (301)364-1855 Fax (301)731-0188

TABLE OF CONTENTS

1.	Introduction							
	1.1 Project Summary 3							
	1.2 Points of Contact(s)							
	1.3 Project Area4							
2.	Project Details							
	2.1 Survey Equipment5							
	2.2 Survey Point Details5							
	2.3 Network Design5							
	2.4 Field Survey Procedures and Analysis6-7							
	2.5 Adjustment8							
	2.6 Data Processing Procedures							
3.	Final Coordinates9							
4.	GPS Observation & Re-Observation Schedule							
5.	Point Comparison Report9							
6.	DeliverablesSent via Electronic Transfer							
	Including: a) Point Documentation Report & Photos of Survey Points							
	b) Final Coordinate List in Excel Format							
	c) NGS Data Sheets for Project Controls							

1. INTRODUCTION

1.1 Project Summary

Dewberry Consultants LLC is under contract to the United States Geological Survey to provide 9 Ground Control Points in the state of California. Under the above referenced USGS Task Order, Dewberry is tasked to complete the quality assurance of LiDAR products. As part of this work Dewberry staff will complete Ground Control Point surveys that will be used to evaluate vertical and horizontal accuracy. The ground survey was conducted February 22 thru February 24, 2017.

Existing NGS Control Points were located and surveyed to check the accuracy of the RTK/GPS survey equipment with the results shown in Section 2.4 of this Report.

As an internal QA/QC procedure and to verify that the Ground Control Points meet the 95% confidence level approximately 50% of the points were re-observed and are shown in Section 5 of this report.

Final horizontal coordinates are referenced to CA State Plane, NAD83 in US Survey Feet. Final Vertical elevations are referenced to NAVD88 in US Survey Feet using Geoid model 2012B (Geoid12B).


1.2 Points of Contact

Questions regarding the technical aspects of this report should be addressed to:

Dewberry Consultants LLC

Gary D. Simpson, L.S. Senior Associate 10003 Derekwood Lane Suite 204 Lanham, Maryland 20706 (301) 364-1855 direct (301) 731-0188 fax

1.3 Project Area

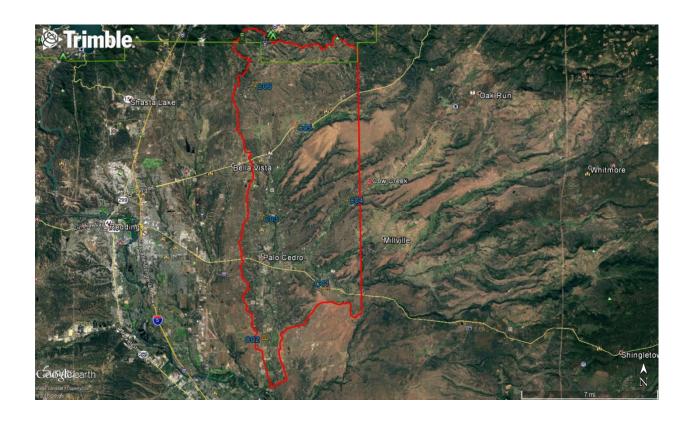

PROJECT DETAILS

2.1 Survey Equipment

In performing the GPS observations Trimble R-10 GNSS receiver/antenna attached to a two meter fixed height pole with a Trimble TSC3 Data Collector to collect GPS raw data were used to perform the field surveys.

2.2 Survey Point Detail

The 9 Ground Control Points were well distributed throughout the project area.

A sketch was made for each location and a nail was set at the point where possible or at an identifiable point. The Ground Control Point locations are detailed on the "Check Point Documentation Report" sheets attached to this report.

2.3 Network Design

The GPS survey performed by Dewberry Consultants LLC office located in Lanham, MD was tied to a Real Time Network operated by CRTN. The network is a series of "real-time" continuously operating, high precision GPS reference stations. All of the reference stations have been linked together using Trimble GPSNet software, creating a Virtual Reference Station System (VRS).

The Trimble NetR5 Reference Station is a multi-channel, multi-frequency GNSS (Global Navigation Satellite System) receiver designed for use as a stand-alone reference station or as part of a GNSS infrastructure solution. Trimble R-Track technology in the NetR5 receiver supports the modernized GPS L2C and L5 signals as well as GLONASS L1/L2 signals.

2.4 Field Survey Procedures and Analysis

Dewberry field surveyors used Trimble R-10 GNSS receivers, which is a geodetic quality dual frequency GPS receiver, to collect data at each surveyed location.

All locations were occupied once with approximately 50% of the locations being reobserved. All re-observations matched the initially derived station positions within the allowable tolerance of \pm 5cm or within the 95% confidence level. Each occupation which utilized the VRS network was occupied for approximately three (3) minutes in duration and measured to 180 epochs.

Each occupation which utilized OPUS (if used) was occupied between 20 and 30 minutes.

Field GPS observations are detailed on the "Control Point Documentation Reports" submitted as part of this report.

Two (2) existing NGS monument listed in the NSRS database were located as an additional QA/QC method to check the horizontal and vertical accuracy of the VRS network as well as being the primary project control monuments designated as AE9984 and AF8158. The results are as follows:

	Observed Values			Data Sheet Values					
PT. #	NORTHING	EASTING	ELEVS.	NORTHING	EASTING	ELEVS.	ΔΧ	ΔΥ	ΔΖ
HPGNDCA02HK	2079832.451	6512130.865	533.808	2,079,832.42	6,512,130.88	533.7	0.031	-0.015	0.108
HPGNDCA02JK	2134349.985	6527304.641	1079.253	2,134,349.99	6,527,304.65	1079.2	-0.005	-0.009	0.053

The above results indicate that the VRS network is providing positional values within the 5cm parameters for this survey.

NGS Monuments



2.5 Adjustment

The survey data was collected using Virtual Reference Stations (VRS) methodology within a Virtual Reference System (VRS).

The system is designed to provide a true Network RTK performance, the RTKNet software enables high-accuracy positioning in real time across a geographic region. The RTKNet software package uses real-time data streams from the CRTN system user and generates correction models for high-accuracy RTK GPS corrections throughout the network. Therefore, corrections were applied to the points as they were being collected, thus negating the need for a post process adjustment.

2.6 Data Processing Procedures

After field data is collected the information is downloaded from the data collectors into the office software. The Software program used is called Trimble Business Center.

Downloaded data is run through the TBC program to obtain the following reports; points report, point comparison report and a point detail report. The reports are reviewed for point accuracy and precision.

After review of the point data an "ASCII" or "txt" file which is the industry standard is created. Point files are loaded into our CADD program (Carlson Survey 2016) to make a visual check of the point data (Pt. #, Coordinates, Elev. and Description). The data can now be imported into the final product.

3. FINAL COORDINATES/ELEVATIONS

CA SPCS NAD83, NAVD88, Geoid 12B						
Point #	Northing (ft)	Easting (ft)	Elevation (ft)			
C01	2080188.60	6512192.20	531.26			
C01A	2080135.54	6512185.15	531.84			
C02	2066355.05	6495476.91	422.74			
C03	2099326.99	6495517.16	533.76			
C04	2104468.48	6518923.03	568.23			
C05	2124353.53	6504834.81	618.90			
C05A	2124348.11	6504874.08	618.27			
C06	2135662.02	6493688.20	774.22			
C06A	2135644.68	6493684.29	773.62			

4. GPS OBSERVATIONS

	OBSERV.	JULIAN	TIME OF DAY	RE-OBSERV.	RE-OBSERV.
POINT ID	DATE	DATE	(AST)	DATE	TIME
C01	3/1/2017	60	14:45	3/2/2017	11:53
CO1A	3/1/2017	60	16:59	3/2/2017	12:00
C02	3/1/2017	60	16:22	3/2/2017	12:29
С03	3/1/2017	60	13:04	N/A	N/A
C04	3/1/2017	60	13:45	N/A	N/A
C05	3/1/2017	60	10:11	3/2/2017	10:11
C05A	3/1/2017	60	10:22	3/2/2017	10:21
C06	3/1/2017	60	10:48	N/A	N/A
C06A	3/1/2017	60	10:58	N/A	N/A

5. POINT COMPARISON

Point ID	Point CK	Delta North (ft)	Delta East (ft)	Vertical Difference (ft)
C01	CO1CK	0.02	-0.02	0.00
CO1A	C01ACK	-0.02	0.00	0.05
C02	CO2CK	-0.01	0.03	0.09
C05	CO5CK	0.00	0.04	0.01
C05A	C05ACK	-0.02	-0.01	0.01